

Vertiv[™] Avocent[®] MergePoint Unity[™] KVM over IP and Serial Console Switch for Dell

Firmware Release Notes

VERSION 2.14.0, JANUARY 2025

Release Notes Section Outline

- 1. Update Instructions
- 2. Appliance Support Information
- 3. Features and Enhancements
- 4. Notes
- 5. Client/Browser Information
- 6. Flash Update Failure Recovery
- 7. Java Viewer Session Expired Certificate Information

1. Update Instructions

For detailed instructions on updating your switch, please refer to your user documentation.

WARNING: After upgrading to version 2.12.4 or newer firmware, the Vertiv[™] Avocent[®] MergePoint Unity[™] switch for Dell cannot be downgraded to a firmware version earlier than 2.12.4. For more information, contact Technical Support.

2. Appliance Support Information

The following appliances are supported with this release.

VERTIV™ AVOCENT® MERGEPOINT UNITY™ SWITCH	FIRMWARE
DMPU108E	FL0651-AVODELL-2.14.0.26173.fl
DMPU2016	FL0651-AVODELL-2.14.0.26173.fl
DMPU4032	FL0651-AVODELL-2.14.0.26173.fl

NOTE: For CentOS targets, use a single or dual mouse cursor with AMS disabled.

3. Features and Enhancements

The following features and enhancements are available with this release of the Vertiv™ Avocent® MergePoint Unity™ switch for Dell.

• Added support for the integration of the Vertiv™ Avocent™ DSView™ Solution.

NOTE: The Vertiv™ Avocent® MergePoint Unity™ switch for Dell must be at firmware version 2.14.0 or higher to be managed by the Vertiv™ Avocent® DSView™ Solution.

- Added the following product security enhancements:
 - Added an option to allow SSH (port 22) to be disabled.



- Added an option to allow the HTTP Strict Transport Security Max-Age to be configured.
- Disabled the Internet Control Message Protocol (ICMP) timestamp responses to address the ICMP Timestamp Request Remote Date Disclosure vulnerability.

4. Notes

If the appliance is going to be enrolled in the Vertiv[™] Avocent[®] DSView[™] management software, firmware version 2.14.0 requires Vertiv[™] Avocent[®] MergePoint Unity[™] switch for Dell plug-in version 2.10.1.

5. Client/Browser Information

NOTE: Microsoft Internet Explorer versions 8 and 9 are no longer supported as client browsers.

The following chart indicates the latest version tested.

SOFTWARE	VERSION
Java	1.8.0.291
Internet Explorer	11
Firefox	107.0 (64 Bit)
Chrome	108.0.5359.125 (64 Bit)
Edge	108.0.1462.54 (64 Bit)

6. Flash Update Failure Recovery

If the switch doesn't boot into the new firmware after a Flash procedure, it is possible to revert to the previous firmware version.

To revert to the previous firmware version:

- 1. Connect a serial cable to the Setup port on the rear panel of the switch.
- 2. Run a terminal program on the PC connected to the Setup port. The serial port settings should be: 9600 baud, 8 data bits, 1 stop bit, no parity and no flow control.
- 3. Turn on the switch.
- 4. Press any key when the Hit any key to stop autoboot prompt appears in the terminal program.
- 5. Once a menu is displayed in the terminal program, press 1 to select Boot Alternate, and then press Enter.
- 6. The switch will then reboot to the previous version automatically.

7. Java Viewer Session Expired Certificate Information

Java KVM viewer session certificates existing in older firmware versions expired on March 6, 2024. After that date, Java prevented KVM sessions from launching unless you update to the newest firmware or edit the Java Console Security settings on each client computer by adding the appliance IP address in the Exception Site List.

© 2025 Vertiv Group Corp. All rights reserved. Vertiv[™] and the Vertiv logo are trademarks or registered trademarks of Vertiv Group Corp. All other names and logos referred to are trade names, trademarks or registered trademarks of their respective owners. While every precaution has been taken to ensure accuracy and completeness here, Vertiv Group Corp. assumes no responsibility, and disclaims all liability, for damages resulting from use of this information or for any errors or omissions.